



BLUE BIRD

June 28, 2007

TO: AFFECTED NORTH AMERICAN DEALERS

**SUBJECT: SERVICE BULLETIN S07LU C.E. WHITE CHILD RESTRAINT
TRACK MOUNTED SEATS WALL ATTACHING BRACKET**

MODELS

**AFFECTED: CERTAIN 2006 MODEL YEAR ALL AMERICAN FRONT ENGINE
BUSES**

On certain 2006 model year Blue Bird All American front engine buses equipped with C.E. White track mounted child restraint seats, the bracket that attaches the seat to the bus wall may crack and eventually break. The original bracket must be replaced with a new designed bracket according to the instructions in service Bulletin S07LU attached.

The replacement bracket and fasteners are available from Blue Bird Service Parts.

Labor time required to identify the C. E. White Child Restraint Seat with wall mount bracket is 0.1 hour per bus. Labor time required to remove and replace the passenger seat wall attaching bracket is 1 hour per bus.

A printout of your buses affected by Service Bulletin S07LU is enclosed.

Service Bulletin S07LU is being mailed directly to owners. Owners are being advised to contact their distributor for assistance, if needed.

Service Bulletin S07LU expires one (1) year from date of issue.

Questions regarding Service Bulletin S07LU should be directed to your Blue Bird Service Representative.

Sincerely,

Bill Coleman

Blue Bird Corporation

478-822-2242

wpcolema@blue-bird.com

BLUE BIRD CORPORATION

P.O. Box 937 • Fort Valley, Georgia 31030

Phone: (478) 825-2021



June 28, 2007

Dear Blue Bird Owner,

You will find enclosed a copy of Service Bulletin S07LU regarding the passenger seat wall attaching bracket on certain 2006 model year Blue Bird All American front engine buses equipped with C.E. White track mounted child restraint seats located over the front wheelhouse

The bracket that attaches the seat to the bus wall may crack and eventually break. The original bracket must be replaced with a new designed bracket according to the instructions provided in Service Bulletin S07LU. Copy attached.

Your buses affected by Service Bulletin S07LU are identified by Blue Bird body number on the enclosed cover sheet.

Labor time required to identify the C. E. White track mounted child restraint seats with wall mount bracket is 0.1 hour per bus. Labor time required to remove and replace the passenger seat wall attaching bracket is 1 hour per bus. A qualified repair technician should perform Service Bulletin S07LU.

Parts required are available from your usual Blue Bird Service Parts source.

Service Bulletin S07LU expires one (1) year from date of issue.

Should you have any questions concerning this bulletin, please contact your Blue Bird dealer or factory service representative.

Sincerely,

Bill Coleman
Blue Bird Body Company
P.O. Box 937
Fort Valley GA 31030
Phone: (478) 822-2242

BLUE BIRD CORPORATION
P.O. Box 937 • Fort Valley, Georgia 31030
Phone: (478) 825-2021



Seat Mounting Bracket

MODELS AFFECTED: A3FE All Americans with CE White Child Restraint Track Mounted Seats

BULLETIN

ISSUE

The seat to wall gusset mounting bracket on CE White Child Restraint track mounted seats located above the front wheelhousing may crack and break.

CORRECTIVE ACTION

Determine which track mounted seats over the front wheelhousing are installed with a seat to wall gusset mounting bracket and replace the mounting bracket.

WARNING Always follow all Federal, State, Local, and Shop safety standards and use proper safety equipment when performing these procedures.

PROCEDURE

- 1** Park vehicle on a level surface, apply parking brake, turn engine off and remove ignition key.
- 2** Remove seat cushion.
- 3** Remove and discard seat to wall gusset mounting bracket and all attaching hardware.
- 4** Attach the new bracket 0100293 to seat frame with fasteners and spacers, per diagram on page 2.


- 5** Place the seat and bracket on top of wall gusset seat ledge. Using the new bracket as a guide, drill three (3) 13/32" diameter holes. Attach bracket to gusset seat ledge per diagram, page 2.

CAUTION Do not remove seat from track mounting in floor. Replacement of seat in wrong location may violate FMVSS requirements for seat spacing.

- 6** Reinstall seat cushion.
- 7** Place bus back into service.

S07LU

S E R V I C E B U L L E T I N

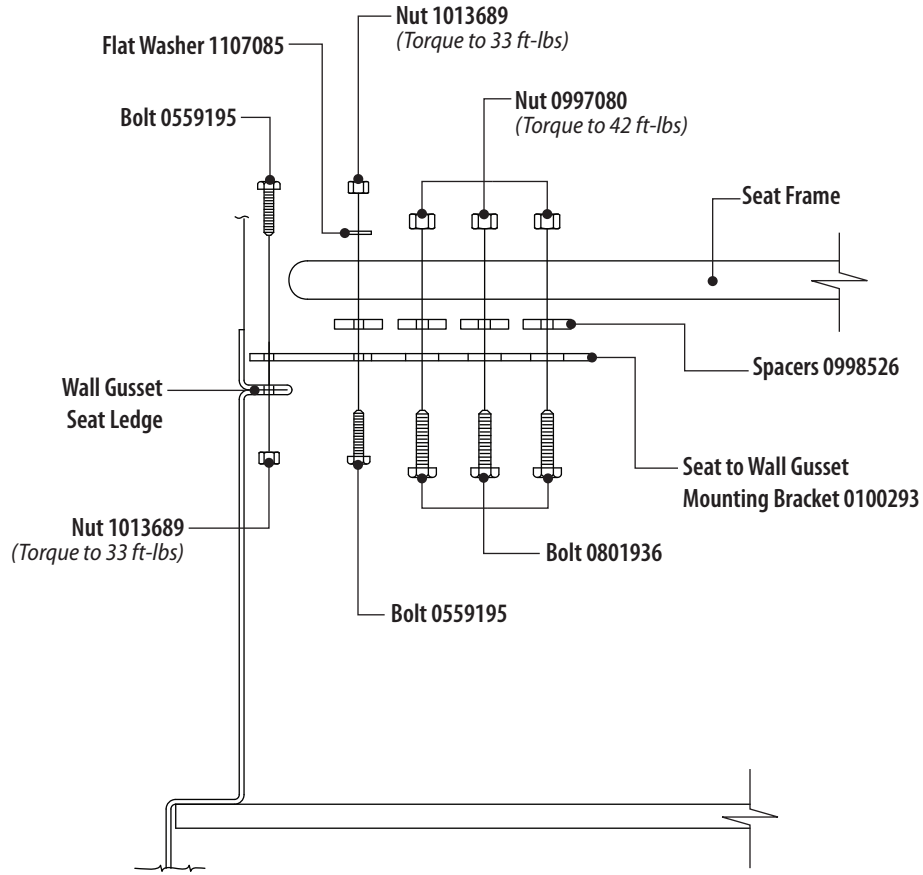

PARTS LIST

PART NUMBER	QUANTITY	DESCRIPTION
0100293	1	Bracket, Gusset, Seat, CEW
0559195	4	Capscrew, Hex Head 3/8-16 X 1", Grade 8
0801936	3	Capscrew, Hex Head 7/16-14 X 1 1/4" Grade 8
0997080	3	Nut, Hex Head, 7/16-14, Locking, Grade 8 Cadmium Wax
1013689	4	Nut, Hex Head, 3/8-16, Washer Serrated
0998526	4	Spacer, .250 X 1 1/4 X 1 1/4 with 0.531 hole
1107085	1	Washer, Flat, 13/32 X 13/16 X 3/32 Hardened, Black