

JULY 27, 2007

TO: NORTH AMERICAN DEALERS

SUBJECT: SERVICE BULLETIN S07LZ PDU CLOSEOUT FASTENERS

MODELS

AFFECTED: 2004-08 MODEL YEAR VISION (BBCV) BUSES

On certain 2004-2008 Blue Bird "Vision" (BBCV) buses incorrect fasteners were used to attach the closeout panel to the Power Distribution Unit (PDU). The fasteners must be removed and replaced according to the instruction provided in Service Bulletin S07LZ. Copy attached.

Parts required to perform Service Bulletin S07LZ are available from Blue Bird Service Parts.

Time required to remove and replace the PDU closeout panel fasteners is 0.2 hours (12 minutes) per bus. Claims for labor (if any) and parts to perform Service Bulletin S07LZ may be submitted to dealers, if performed within one (1) year of date of issue of this bulletin. Use the "Create Campaign/Bulletin Claim form" Function in BBOND/Claim Trac to submit claims.

A printout of your buses affected by Service Bulletin S07LZ is enclosed.

Service Bulletin S07LZ is being mailed directly to owners. Owners are being advised to contact their Blue Bird dealer for assistance, if needed. Claims for labor (if any) by a repair facility other than a Blue Bird dealer, shall be channeled through the assisting Blue Bird dealer.

Service Bulletin S07LZ expires one (1) year from date of issue.

Questions regarding Service Bulletin S07LZ should be directed to your Blue Bird Service Representative.

Sincerely,

Bill Coleman
Blue Bird Corporation
478-822-2242
wpcolema@blue-bird.com

July 27, 2007

Dear Blue Bird Owner,

You will find enclosed a copy of Service Bulletin S07LZ regarding the Power Distribution Unit (PDU) close out fasteners on 2004-08 model year Blue Bird "Vision" buses.

Incorrect fasteners were used to secure the closeout panels for the power distribution Unit. The original closeout panel fasteners must be removed and replaced with the correct fasteners according to the instructions provided in Service Bulletin S07LZ. Copy attached.

Your bus(es) affected by Service Bulletin S07LZ are identified by Blue Bird body number on the enclosed cover sheet.

A qualified repair technician should perform Service Bulletin S07LZ. Replacement fasteners are available from your Blue Bird Dealer or Bus Care/Bus Spec parts source.

Labor time required to remove and replace the PDU closeout panel fasteners is 0.2 hours (12 minutes) per bus. You may request reimbursement for labor from your Blue Bird Dealer or Bus Care/Bus Spec parts source if modifications are performed within one year from the date Service Bulletin S07LZ was issued.

Service Bulletin S07LZ expires one (1) year from date of issue.

Should you have any questions concerning this bulletin, please contact your Blue Bird dealer or factory service representative.

Sincerely,



Bill Coleman
Blue Bird Corporation
478-822-2242
wpcolema@blue-bird.com



PDU Closeout Fasteners

MODELS AFFECTED: Certain 2004-2008 BBCV Visions

BULLETIN

ISSUE

The fasteners used to attach the closeout panel to the Power Distribution Unit (PDU) may not be the correct length.

CORRECTIVE ACTION


Remove the incorrect length fasteners and replace with the correct length fasteners.

WARNING Always follow all Federal, State, Local, and Shop safety standards and use proper safety equipment when performing these procedures.

PROCEDURE

- 1 Park vehicle on a level surface, apply parking brake, turn engine off, and remove ignition key.
- 2 Loosen two thumb screws and remove the PDU cover.
- 3 Remove and discard seven Closeout Panel to PDU capscrews.

- 4 Install seven new capscrews (0000610) with washers (2127173) provided for the Closeout Panel to the PDU.
- 5 Reinstall the PDU cover.
- 6 Return the bus to service.

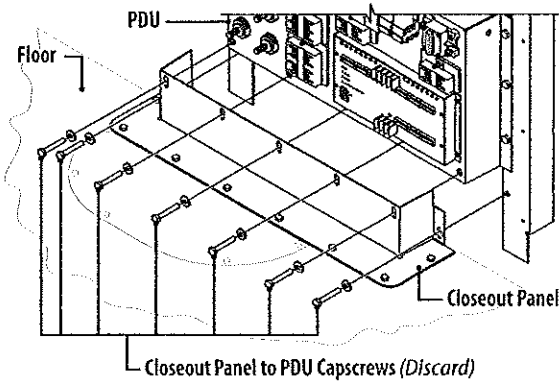

PARTS LIST

PART NUMBER	QUANTITY	DESCRIPTION
0000610	7	Capscrew, Hex, 5/16-18x1/2
2127173	7	Washer, Flat, 5/16

S07LZ

S E R V I C E B U L L E T I N